
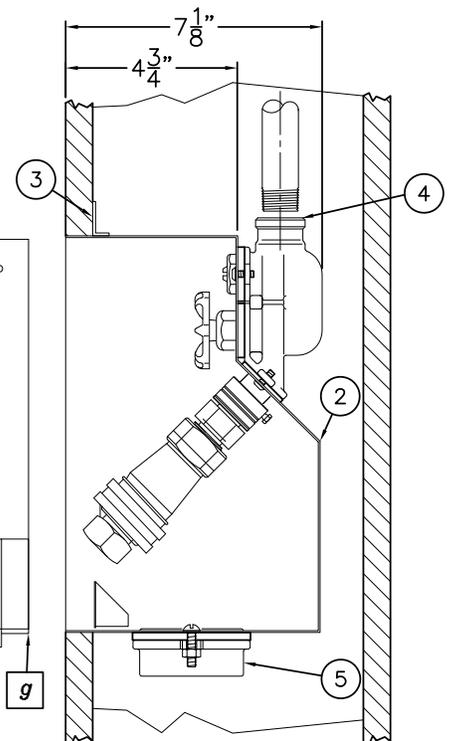


REFERENCE DRAWINGS	
REPAIR PARTS	9989-070-001
BITS & DRIVERS	9951-001-002

- a** 3/4" MALE HOSE THREAD.
- b** REMOVABLE WHEEL LOOSE KEY HANDLE 1/4"-5/16" SQUARE TAPER.
- c** LOCKSHIELD SCREWDRIVER STOP.
- d** #10-32 UNF X 1" PHILLIPS TRUSS HEAD WALL FLANGE / DOOR ANCHORING SCREWS.
- e** GRAY FOAM WEATHERSTRIPPING TAPE.

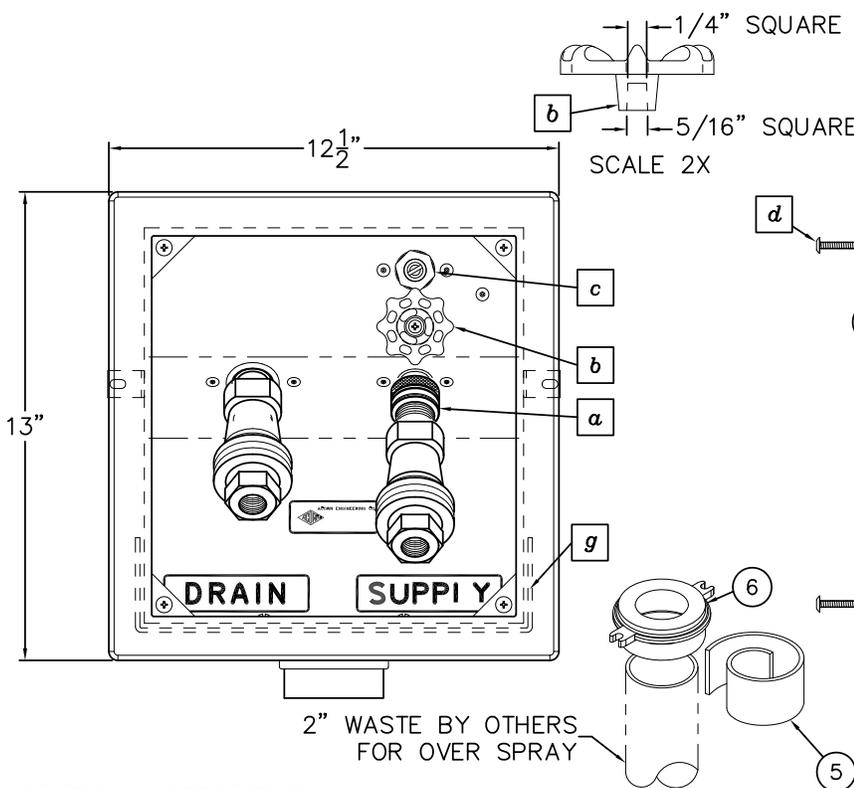

INSTALLATION INSTRUCTIONS:

- A- REMOVE THE WALL FLANGE ① SHOWN FROM THE THE BOX ② .
- B- SELECT RECESSED MOUNTING LOCATION AND BLOCK OUT AND/OR PROVIDE ADEQUATE WALL BACKING OR FRAMING BY OTHERS.
- C- USING MOUNTING TABS ③ , POSITION AND SECURE THE BOX TO THE STUD FRAMING OR WALL BACKING WITH THE BOX OPENING FLUSH WITH THE FINISHED WALL. PLUMB AND LEVEL AS REQUIRED.

- D- MAKE UP CONNECTIONS TO ④ 3/4" NPTI VALVE INLET(S). WRAP PERMASEAL TAPE ⑤ AROUND 2" OVER SPRAY WASTE LINE BY OTHERS AND INSERT INTO 2" SPS ⑥ HOSE RECEPTOR PRESSING FIRMLY TO SEAL. MAKE UP CONNECTIONS TO ⑦ 3/4" NCT WASTE CONNECTION BY OTHERS AS REQUIRED.
- E- INSTALL WALL FLANGE ① TO THE RECESSED BOX ② TO COMPLETE THE INSTALLATION.

NOTE: MAXIMUM RECOMMENDED WORKING WATER PRESSURE IS 100 PSI; MAXIMUM TEMPERATURE IS 130° F.

WARNING: PRIOR TO MAKING INSTALLATION, SUPPLY LINES MUST BE FLUSHED OF ALL FOREIGN MATERIAL SUCH AS PIPE DOPE, CHIPS, SOLDER, ETC. VALVE MUST BE DRAINED PRIOR TO BEING SUBJECTED TO FREEZING TEMPERATURES.

ACORN ENGINEERING COMPANY P.O. BOX 3527 Industry, CA 91744 15125 Proctor Ave Industry, CA 91746 (626) 336-4561 FAX (626) 961-2200	TITLE 8198 SERIES RECESSED LASER SUPPLY AND WASTE HOSE BOX		
	MANUFACTURE DATE AUGUST 1979 TO PRESENT	DATE ISSUED 03/11/10	DRAWING NUMBER 9901-060-001
	DATE REVISED 02/17/12		