
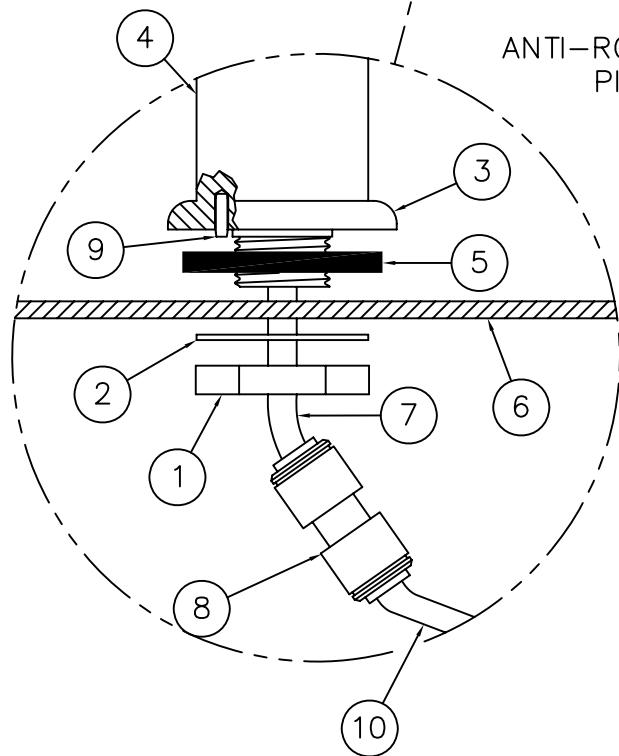


-DMJ DECK MOUNTED
"J" SPOUT SHOWN
FOR REFERENCE

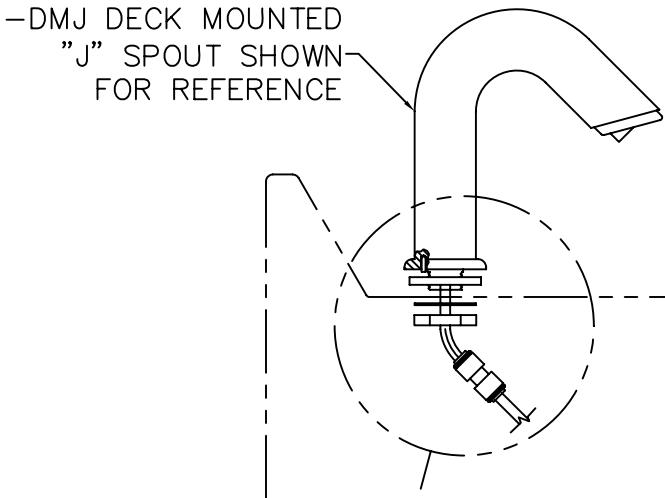

REFERENCE DRAWING	
DECK MTD 'L' SPOUT	9957-730-001
DECK MTD 'J' SPOUT	9957-731-001
BACKSPLASH MTD SPOUT	9957-732-001
9VDC SENSOR	9955-019-001

INSTALLATION INSTRUCTIONS:

NOTE: INSTALL SPOUTS PRIOR TO SECURING FIXTURE TO WALL.

A-REMOVE BRASS NUT ① AND WASHER ② FROM THE BASE ③ OF SPOUT ④. DO NOT REMOVE RUBBER GASKET ⑤.

B-FROM ABOVE DECK ⑥: MAKE SURE RUBBER GASKET ⑤ IS PROPERLY SEATED WITHIN THE BASE ③ OF SPOUT ④. FEED TUBE ⑦ AND UNION FITTING ⑧ THRU PUNCHED OPENING. POSITION SPOUT ③ ON DECK ⑥ WITH ANTI-ROTATION PIN ⑨ THRU DECK PUNCHING ANTI-ROTATION SLOT.

C-FROM BELOW DECK ⑥: REASSEMBLE BRASS NUT ① AND WASHER ② TO THE BASE ③ OF SPOUT ④. MAKE SURE THAT PIN ⑨ IS IN THE PUNCHING SLOT AND THAT GASKET ⑤ SEALS PROPERLY BEFORE TIGHTENING.

D-CONNECT POLYETHYLENE 1/4" O.D. WATER LINE ⑩ TO UNION FITTING ⑧ WATERTIGHT WITH THE FERRULE NUT PROVIDED. REFER TO THE GENERAL INSTALLATION INSTRUCTIONS FOR ADDITIONAL DETAILS.